


three inches = one foot
one and one half inches = one foot
one inch = one foot
three quarters inch = one foot
one half inch = one foot
three eighths inch = one foot
one quarter inch = one foot
one eighth inch = one foot

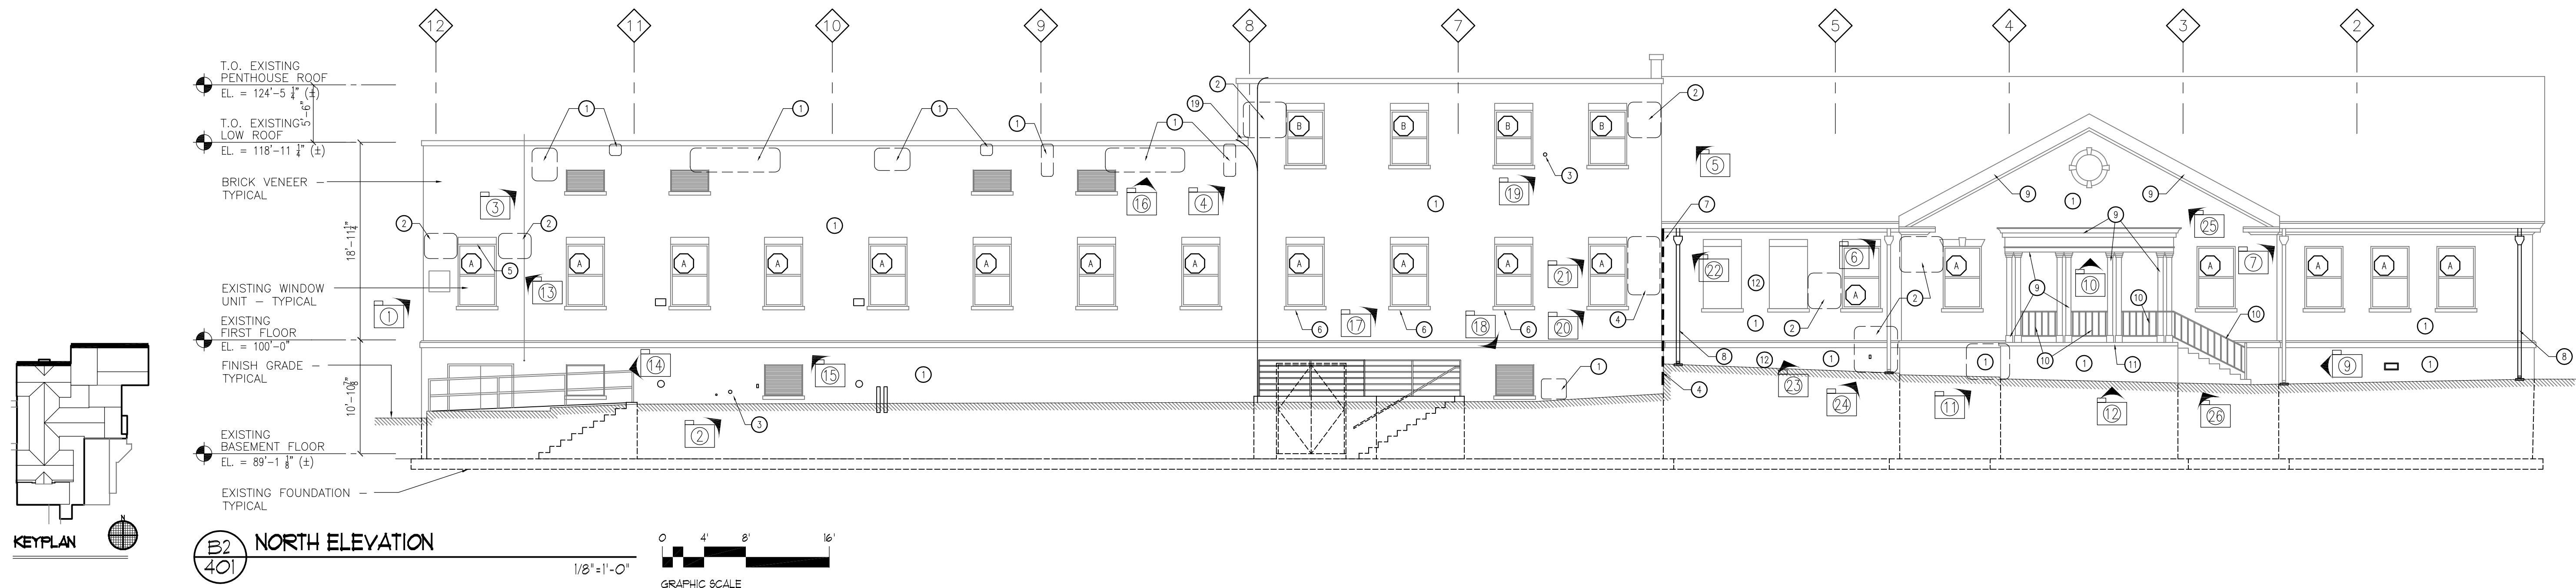

- SYMBOLS LEGEND**
- SEALANT REPLACEMENT
 - ⑨ DIRECTIONAL PHOTO REFERENCE - SEE NUMBER BELOW EACH PHOTO
 - ⑤ WINDOW TYPE. SEE SHEET AS-890.
 - DTL SHI DETAIL REFERENCE
 - ① KEY NOTE
 - ⑤ EXISTING COLUMN LINE

- GENERAL NOTES**
- A. REFER TO SYMBOLS LEGEND, GENERAL NOTES, KEYNOTES AND DRAWINGS FOR EXTENT OF WORK.
 - B. VERIFY ALL DIMENSIONS AND CONDITIONS AT JOB SITE. PORTIONS OF EXISTING CONSTRUCTION MAY HAVE BEEN MODIFIED BY OWNER.
 - C. MAINTAIN CONTINUOUS UTILITY SERVICE TO ALL SPACES IN THE BUILDING NOT AFFECTED BY THIS WORK. COORDINATE WITH COTR ANY DISRUPTION IN SERVICES REQUIRED TO PERFORM WORK OR TO MODIFY EXISTING PIPING, DUCTWORK OR ANY ASSOCIATED EQUIPMENT.
 - D. ANY ADJACENT WORK DAMAGED DURING SEALANT OR MORTAR REMOVAL SHALL BE REMOVED COMPLETELY AND NEW MATERIALS INSTALLED AT NO COST TO THE OWNER.
 - E. CLEAN ALL SURFACES OF MASONRY WALLS AND STONE UNITS TO PROVIDE A UNIFORM CLEAN APPEARANCE.
 - F. THE ELEVATIONS AND PHOTOGRAPHS IN THESE DOCUMENTS ILLUSTRATE THE EXISTING CONDITIONS OF THE BUILDING EXTERIOR. THE NOTATIONS DO NOT LIMIT THE AREA OF WORK TO COMPLETE THE MASONRY AND STONE CLEANING, TUCKPOINTING OR REPAIR WORK.

- KEYNOTES**
- ① REMOVE STAINS. CLEAN STONE UNITS, MASONRY UNITS AND MORTAR.
 - ② RE-POINT MORTAR JOINTS. REMOVE LOOSE MORTAR JOINTS.
 - ③ SEAL PENETRATIONS AND OPENINGS AT EXTERIOR WALL.
 - ④ REPLACE DAMAGED/MISSING BRICKS. CLEAN SURFACE, AND TUCKPOINT ADJACENT MORTAR JOINTS.
 - ⑤ CLEAN AND PREP RUSTED STEEL LINTEL / METAL CLADDING. PAINT LINTEL TO MATCH BRICK. PAINT METAL CLADDING TO MATCH EXISTING.
 - ⑥ INSPECT AREA. TUCKPOINT MORTAR JOINTS WHERE REQUIRED.
 - ⑦ REBUILD CORNER AND PROVIDE NEW BRICK EXPANSION JOINT (BEU).
 - ⑧ ADD NEW DOWNSPOUT TO MATCH EXISTING DOWNSPOUT.
 - ⑨ REMOVE PEELING PAINT. CLEAN AND PREP ALL WOOD AREAS, INCLUDING GORINGS. REPLACE ANY DETERIORATING WOOD AND REPLACE TO MATCH EXISTING. PRIME AND PAINT WOOD SURFACES TO MATCH EXISTING.
 - ⑩ REMOVE PEELING PAINT. CLEAN AND PREP METAL ITEMS INCLUDING METAL FACIA, STEEL RAILINGS, BEAMS, POSTS AND COLUMNS. PRIME AND PAINT TO MATCH EXISTING.
 - ⑪ REPAIR SPALLING CONCRETE AT STOOP.
 - ⑫ REMOVE VEGETATION GROWTH AND DEBRIS FROM BRICKS AND OTHER BLDG COMPONENTS. CLEAN BRICKS AND MORTAR.
 - ⑬ REPAIR OR REPLACE DAMAGED CONCRETE UNITS TO MATCH EXISTING. CLEAN AND REMOVE STAINS.
 - ⑭ REPLACE BRICK EXPANSION JOINT SEALANT. REMOVE EXISTING SEALANT, CLEAN AND PREP JOINT. PROVIDE NEW BACKER ROD AND SEALANT.
 - ⑮ REINSTALL AND SECURE LOOSE LIGHTING PROTECTION CABLE.
 - ⑯ REMOVE AND REPLACE SEALANT JOINT. CLEAN MASONRY UNITS.
 - ⑰ REPAIR AND REPLACE DAMAGED ROOFING MATERIAL AND FLASHING.
 - ⑱ PROVIDE MISSING DOWNSPOUT. REPAIR AND CONNECT TO SCUPPER.
 - ⑲ REPLACE DAMAGED MISSING CORING AND FLASHING TO MATCH EXISTING.
 - ⑳ REPLACE DAMAGED PLASTER / GYP. BD. SMOOTH. PATCH HOLES AND PAINT TO MATCH EXISTING.
 - ㉑ REPLACE DAMAGED WINDOW SCREEN.
 - ㉒ REMOVE EXISTING STORY BEAM SLEEVE AND CAP AS NECESSARY.
 - ㉓ PROVIDE AND INSTALL NEW GUTTER.
 - ㉔ NEW RELIEF SCUPPER.
 - ㉕ NEW LOUVER. REFER TO HVAC DRAWINGS.



NORTH ELEVATION 13



NORTH ELEVATION 14



NORTH ELEVATION 15



NORTH ELEVATION 16



NORTH ELEVATION 17



NORTH ELEVATION 18



NORTH ELEVATION 19



NORTH ELEVATION 20



NORTH ELEVATION 21



NORTH ELEVATION 22



NORTH ELEVATION 23



NORTH ELEVATION 24



NORTH ELEVATION 25



NORTH ELEVATION 26

FINAL BID DOCUMENTS 90% CONSTRUCTION DOCUMENTS SUBMISSION 05-17-12 50% CONSTRUCTION DOCUMENTS SUBMISSION 04-06-12 35% DOCUMENTS SUBMISSION 02-22-12 SCHEMATIC DESIGN SUBMISSION 11-21-11 Revisions: Date	Federal Health Care Center U.S. Department of Veterans Affairs U.S. Department of Defense Captain James A. Lovell Federal Health Care Center 3001 Green Bay Road North Chicago, IL, 60064	CAPTAIN JAMES A. LOVELL FEDERAL HEALTH CARE CENTER 2010	CONSULTANTS: ARNOLD & O'SHERIDAN Consulting Engineers CHEQUAMEGON BAY ENGINEERING, INC. MACKESEY AND ASSOCIATES, LLC	PROJECT LEADER: Plunkett Rysch Architects 11000 West Park Place • Milwaukee WI 53224 • Tel 414 359-3060 • Fax 414 359-3070 Intelligent Designs Inspired Results www.prarch.com PRA Job No. 110172-01	Drawing Title Exterior Elevations - North and Photos Approved: Project Director	Project Title AE SCIP for Building 6 FHCC Location North Chicago, IL Date June 26, 2012 Checked By: PRA Drawn By: RLS	Project Number 556-11-119 Building Number 6 Drawing Number AS-401	Office of Facilities Management Department of Veterans Affairs
--	--	--	--	--	---	---	---	---